

Sanding/Pre-treatment basics:

When a substrate is to be coated the surface **pre-treatment** is crucial. The better and more precise the preparation e.g. cleaning, sanding of the surface and the final cleaning process, the better the adhesion properties that can be expected. A well-known statement in this industry is:

"A painted surface is only as good as the underlying prepared ground!"

Grinding/Sanding is a method for surface pre-treatment which can be performed manually or mechanically. The process is used to create a desired shape and/or surface roughness through removal of material, rust removal, deburring, smoothing, coarse / fine sanding, roughing, polishing, etc. of metal objects, coated components, wood and mineral objects. Proper grinding/sanding will effectively increase the contact area for optimum adhesion of the coatings.

Overview of the most common abrasives:

Sandpaper, grinding wheels, sanding fleeces, abrasive cloth (fabric), abrasive belts (endless) and sanding discs. For the particular grinding job the abrasive or the abrasive grit must meet various requirements, such as grit hardness criteria and cutting ability, long service life, no or low heat development, uniform distribution of the grit on the sanding paper, etc.

- The abrasives are divided into natural and synthetic materials. Natural grit materials e.g. Garnet, quartz and natural corundum are of little use, primarily due to their insufficient strength properties (except for the natural diamond!).
- Synthetic abrasive such as corundum, silicon carbide, boron nitride, boron carbide and diamond are used because of their excellent properties for almost all grinding operations.
- Corundum is the most commonly used medium due to its excellent hardness and toughness. Depending on the composition of the properties, Corundum is almost 100% white aluminium oxide (9.4 Mohs), and with its remarkable hardness, it can attack virtually any material right from the start. The grit shape is blocky with straight cutting edges.
- Silicon carbide (9.6 Mohs) is next to diamond and boron carbide as the hardest abrasive grit. It features long and free-cutting edges, ideal shapes for an abrasive grit. With a lower toughness, the wear resistance is somewhat lower than that of aluminium oxide (Corundum). It is an excellent medium for use with soft materials.

We recommended:

- Aluminium oxide (noble corundum white) for hard materials
- Silicon carbide for soft materials

In the production of the grinding material, an electro-static process is applied to bond the abrasive grit with the glued pad. This technique provides for a perfect orientation of the abrasive grit. This ensures excellent grinding/cutting performance from the very start. Depending on the grit size and density and on the hardness of the workpiece to be processed, a high wear resistance can be achieved. Continuous extraction of grinding waste will enhance the durability and service life.

For this purpose, the term **"hardness"** is mentioned: if a substance can scratch or damage another it is harder than the other. Under this principle the Mohs scale of hardness (Mohs) has been established. The Mohs scale is from 1 to 10 Mohs (diamond hardness level). To test hardness we use a number of different tests: abrasive hardness test device, pencil hardness device and pendulum hardness device.

Roughness:

One of the main surface parameters of a substrate is its roughness (R). This provides information on the condition of the surface.

The most common roughness definitions are:

Roughness depth R_t	Arithmetic mean deviation R_a	Average roughness (depth) R_z
-----------------------	---------------------------------	---------------------------------

Working speed and the grinding tool strongly affect the resultant surface roughness of the surface. For example, a grinding disk with P320 grit will leave marks when used by hand. These marks will show also after the application of thin lacquers. The same abrasive medium on a rotating sander and with an orbital stroke will produce faster material removal and a fine uniform finish.

Sanding paper is standardized (DIN / ISO) according to "grit" size and bears the letter **P**.

- The series starts at P16 (very coarse) to P1200 (very fine) and to Super Fine (sf). Some manufacturers also use the 'P' standard for products above P1200 up to P4000.
- Likewise, there is a division into wet and dry abrasive paper. Wet sanding is used less and less frequently.
- When sanding is necessary, the instructions of the paint manufacturer should be followed.

Important! When sanding dry old coatings, fillers, etc. it is recommended that you initially use grinding disks of less than P100 sanding paper.

Example:

- Putty is sanded with an eccentric grinding machine and P80 paper.
- The preparation paper grade for application of a filler medium should be P220/P240. Changing from P80 to P220 is a difference of 140 (i.e. 40 more than 100) - This step is too large. There should be another sanding step in between.
- The correct procedure is to prepare 80% of the surface using a P80 grinding disk.
- Continue with P150 to finish the surface to 90%.
- Thereafter use P220 / P240 to complete the surface to 100%.

Sanding chart with eccentric machine (dry):

Substrate	Cleaning	Sanding	Note
Steel	Thinner / Degreaser	P80 – P180	Surface must be free from oil, grease, rust, mill scale and scale
Galvanized steel	Thinner / alkaline cleaner	P180 – P240 Scotch-Brite	Remove products of oxidation and other contamination
Hot dipped galvanized steel	Thinner / alkaline cleaner	P150– P220 Scotch-Brite	Remove products of oxidation and other contamination

Aluminium	Thinner / alkaline cleaner	P180 – P240 Scotch-Brite	Remove products of oxidation and other contamination
Glass fibre (GFK)	Degreaser	P220 – P280 Scotch-Brite	
Putty	Remove dust / Degreaser	P80 – P240	Intermediate sanding step with P150/P180
Surfacer/Primer	Degreaser	P320 – P400	Must be well cured.
Old coating	Degreaser	P320 – P400	Must be well cured.

Liability for content:

The contents of these information sheets have been prepared with great care. However, we cannot take responsibility for their accuracy, completeness or timeliness. Upon notification of errors or of corresponding right violations, we will change the content accordingly. Working with machines, hand tools and chemical products can be very dangerous. Therefore our examples and information are for professional (experienced and skilled) customers only. We cannot guarantee success, nor accept liability for consequential damages, since these depend on the skills of the user, the materials and personal protective clothing used, and the processing conditions